

PROCESSOR TYPE All

PC05-00024 CODE: D ML: B

MAR-72 - PROBLEM: Electronic parts on the punch motor driver assembly are no longer required as a result of a redesign of the driver.
CORRECTION: Revise prints to depict new Triac Driver and change title from SCR DRIVER ASSEMBLY to TRIAC DRIVER ASSEMBLY.
In-plant effectivity -Phase-in when revision "B" 5408384's are available.

PC05-00025 CODE: M ML: C

DEC-72 - PROBLEM: High cost of aluminum bezel.
CORRECTION: Change from aluminum bezel to plastic bezel and use an ultrasonic weld to bond cover to bezel.
In-plant effectivity -02 phase-in

PC05-D0026 CODE: F ML: D

SEP-73 - PROBLEM 1: Potential blowing of 4 AMP fast blow fuse F2 by turning PC05 on and off.
CORRECTION 1: Replace the fast blow fuse with a 4 AMP slow blow fuse #90-07220 on the #70-06512 Power Regulator.
PROBLEM 2: Illustrated Parts Breakdown not included with drawing set.
CORRECTION 2: Add I P B to drawing A-AL-PC05-0-05.
In-plant effectivity -Fuse is being changed by production.
Field effectivity -Retrofit all PC05's if symptoms are present.
(Time To Install And Test .3 Hour.) (Kit Contents -F1059 -FCO/Prints And Parts)